INSPECTION REPORT



SAMPLE REPORT

Prepared for: SAMPLE REPORT Inspection Date: SAMPLE REPORT Prepared by: James Stinson



Handy Home Inspection 10410 Whitmore Lake Brighton, MI 48116 248.756.5081

www.handyhomeinspectionofmichigan.com handyhomeinspection@gmail.com

The best home inspection experience available.

SUMMARY	Report No. 1055
	www.handyhomeinspectionofmichigan.com
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING	INSULATION PLUMBING INTERIOR
REFERENCE	
This Summary outlines potentially significant issues from a cost or safety standpoint. courtesy and cannot be considered a substitute for reading the entire report. Please r Priority Maintenance Items	-
Roofing	
SLOPED ROOFING \ Asphalt shingles Condition: • Leak Implication(s): Chance of water damage to contents, finishes and/or structure Location: Third Floor Task: Replace Time: Immediate Cost: Major	
Condition: • Old, worn out Implication(s): Chance of water damage to contents, finishes and/or structure Location: Various Task: replace Time: Immediate Cost: Major	
Condition: • Granule loss Implication(s): Chance of water damage to contents, finishes and/or structure	
Exterior	
LANDSCAPING \ Retaining wall Condition: • Rot or insect damage Implication(s): Weakened structure Chance of movement Location: Various Task: Further evaluation Time: Immediate	
GARAGE \ Vehicle door operators Condition: • Fails to auto reverse Implication(s): Physical injury Task: Repair Time: Immediate	

Report I	No. 1	055
----------	-------	-----

SUMMARY

www.handyhomeinspectionofmichigan.com

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
---------	---------	----------	-----------	------------	---------	---------	------------	----------	----------

REFERENCE

Structure

ROOF FRAMING \ Sheathing

Condition: • <u>Water stains</u> Implication(s): Material deterioration Task: Further evaluation Time: Immediate

Heating

GAS FURNACE \ General

Condition: • Service furnace Task: Further evaluation Time: Immediate

Interior

WINDOWS \ Frames

Condition: • Rot Implication(s): Chance of damage to structure | Material deterioration Location: Various Task: Replace Time: Discretionary Cost: Major

This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

Home Improvement - ballpark costs

Report	No.	1055
--------	-----	------

ROOFING SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATI

HEATING C

COOLING

INSULATION PLUMBING

www.handyhomeinspectionofmichigan.com

INTERIOR

Description

Sloped roofing material:
 Asphalt shingles

Limitations

Inspection performed: • By walking on roof • From the ground

Recommendations

SLOPED ROOFING \ Asphalt shingles

1. Condition: • Leak

Implication(s): Chance of water damage to contents, finishes and/or structure

Location: Third Floor

Task: Replace

Time: Immediate

Cost: Major





2. Condition: • Old, worn out

Implication(s): Chance of water damage to contents, finishes and/or structure Location: Various Task: replace Time: Immediate Cost: Major

ROOFING

www.handyhomeinspectionofmichigan.com PLUMBING

SUMMARY

ROOFING

STRUCTURE ELECTRICAL HEATING

INSULATION

REFERENCE



2. Old, worn out



4. Old, worn out



3. Old, worn out



5. Old, worn out

ROOFING	Report No. 1055 www.handyhomeinspectionofmichigan.com
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL REFERENCE	HEATING COOLING INSULATION PLUMBING INTERIOR
6 Old, worn out	<image/>
abb <	9 Old, worn out

ROOFING	Report No. 1055
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL REFERENCE	www.handyhomeinspectionofmichigan.com
10. Old, worn out	11. Old, worn out

12. Old, worn out

13. Old, worn out

ROOFING			www.handyhomeinspe	Report No. 1055 ctionofmichigan.com
SUMMARY ROOFING EXTERIOR STRUC	CTURE ELECTRICAL HI	EATING COOLING		
EFERENCE				
	The second secon	Old, worn out		
14. Old, worn out				


ROOFING	- , -	··· , • ••	الأفقاد بقدر أما				www.handyhoi	Repor meinspectionofn	t No. 1055 nichigan.com
SUMMARY ROOF	ING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									

18. Old, worn out

19. Old, worn out

3. Condition: • Granule loss

Implication(s): Chance of water damage to contents, finishes and/or structure

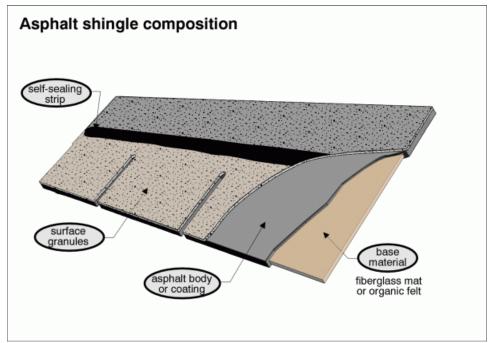

EXTER	IOR						www.handyhoi	Report meinspectionofm	No. 1055
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									
Recomr	nendatic	ons							
WALLS \ T 4. Condition Implication Location: S Task: Repl Time: Disc	on: • Rot h(s): Chanc Second Floo ace		mage to con	tents, finishe	es and/or stru	ucture Mate	rial deteriorat	ion	

20. Rot

21. Rot





LANDSCAPING \ Driveway

5. Condition: • <u>Cracked or damaged surfaces</u> Implication(s): Trip or fall hazard Task: Repair Time: Discretionary

EXTER	RIOR							Repor	t No. 1055
							www.handyho	meinspectionofr	nichigan.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									



23. Cracked or damaged surfaces



24. Cracked or damaged surfaces



25. Cracked or damaged surfaces

LANDSCAPING \ Retaining wall

6. Condition: • Rot or insect damage
Implication(s): Weakened structure | Chance of movement
Location: Various
Task: Further evaluation
Time: Immediate

EXTERIOR

Report No. 1055

www.handyhomeinspectionofmichigan.com

MARY	ROOFING	EXTERIOR	STRUCTURE	ELECTR
IVIARY	ROOFING	EXTERIOR	SIRUCIURE	ELECIR

NG INSULA

PLUMBING INTE

REFERENCE

SUM

NCE



26. Rot or insect damage



28. Rot or insect damage



27. Rot or insect damage



29. Rot or insect damage

EXTERIOR

www.handyhomeinspectionofmichigan.com

1	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLI
		EXTENSION	OINCOTONE	LELOTINOAL	TIEATING	OCCLINC	INCOLATION	

SUMMARY

LUMBING






30. Rot or insect damage



32. Rot or insect damage

GARAGE \ Door into garage

7. Condition: • Door Frame Rotted Location: Back door into garage Task: Repair Time: Discretionary

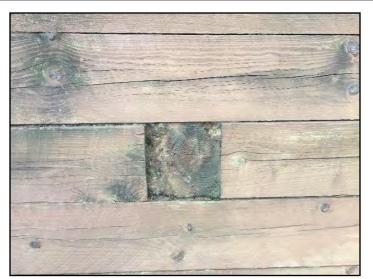


31. Rot or insect damage



33. Rot or insect damage

							www.handyhoi	meinspectionofn	nichigan.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									

8. Condition: • Fails to auto reverse
Implication(s): Physical injury
Task: Repair
Time: Immediate

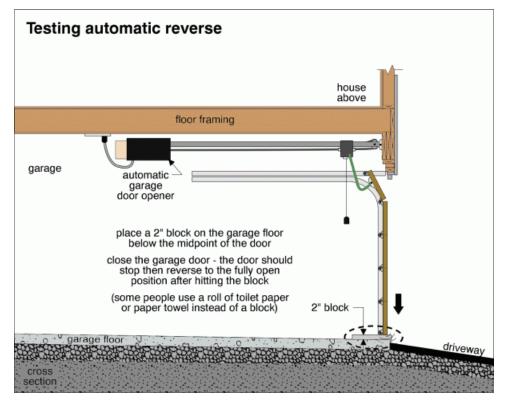

Providing great home inspections for every client every time

Report	No.	1055
--------	-----	------

STRUC	TURE							Repor	t No. 1055	
				www.handyhomeinspectionofmichigan.com						
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	
REFERENCE										
Descrip	tion									
Configura	tion: • Base	ement								
Foundatio	n material:	Poured co	oncrete							
Floor cons	struction: •	<u>Joists</u>								
Exterior w	all construe	ction: • <u>Wo</u>	od frame							
Roof and	ceiling fram	ning: • Rafte	ers/ceiling jois	sts						

Recommendations

ROOF FRAMING \ Sheathing

9. Condition: • <u>Water stains</u> Implication(s): Material deterioration Task: Further evaluation Time: Immediate



35. Water stains



36. Water stains

www.handyhomeinspectionofmichigan.com PLUMBING

STRUCTURE

SUMMARY

STRUCTURE

REFERENCE



37. Water stains



39. Water stains



38. Water stains



40. Water stains

STRUCTURE						t No. 105
				www.handyho	meinspectionofm	nichigan.con
SUMMARY ROOFING	EXTERIOR STRUCTURE	ELECTRICAL HE	ATING COOLIN	G INSULATION	PLUMBING	INTERIOF
EFERENCE						

41. Water stains

Report No	o. 1055
-----------	---------

ELECTRICAL Report No. 1055
www.handyhomeinspectionofmichigan.com
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR
REFERENCE
Description
Service entrance cable and location: • Underground - cable material not visible
Service size: • 200 Amps (240 Volts)
Main disconnect/service box rating: • 200 Amps
Main disconnect/service box type and location: • Breakers - basement
System grounding material and type: • Copper - water pipe and ground rod
Distribution wire material and type: • Copper - non-metallic sheathed
Type and number of outlets (receptacles): • Grounded - typical
Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • GFCI - bathroom • GFCI - kitchen
Smoke detectors: • Present

System ground: • Quality of ground not determined

Report	No.	1055
--------	-----	------

HEATING

							www.handyho	meinspectionofr	nichigan.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									
Descrip	otion								

System type: • Furnace

Fuel/energy source: • Gas

Heat distribution: • Ducts and registers

Efficiency: • <u>High-efficiency</u>

Exhaust venting method: • Direct vent

Approximate age: • 20 years • Near end of life expectancy

Main fuel shut off at: • Meter

Chimney/vent: • PVC plastic

Chimney liner: • Not required

Combustion air source: • Outside

Limitations

Safety devices: • Not tested as part of a building inspectionHeat loss calculations: • Not done as part of a building inspection

Heat exchanger: • Not visible

Recommendations

GAS FURNACE \ General 10. Condition: • Service furnace Task: Further evaluation Time: Immediate



42. Service furnace



43. Service furnace


HEATI	NG							Repor	t No. 1055
							www.handyhoi	meinspectionofm	nichigan.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR








44. Service furnace

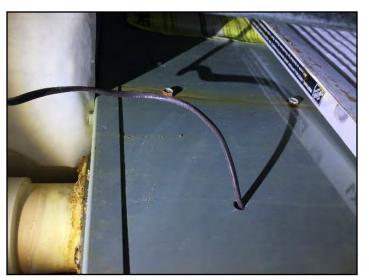

45. Service furnace



46. Service furnace

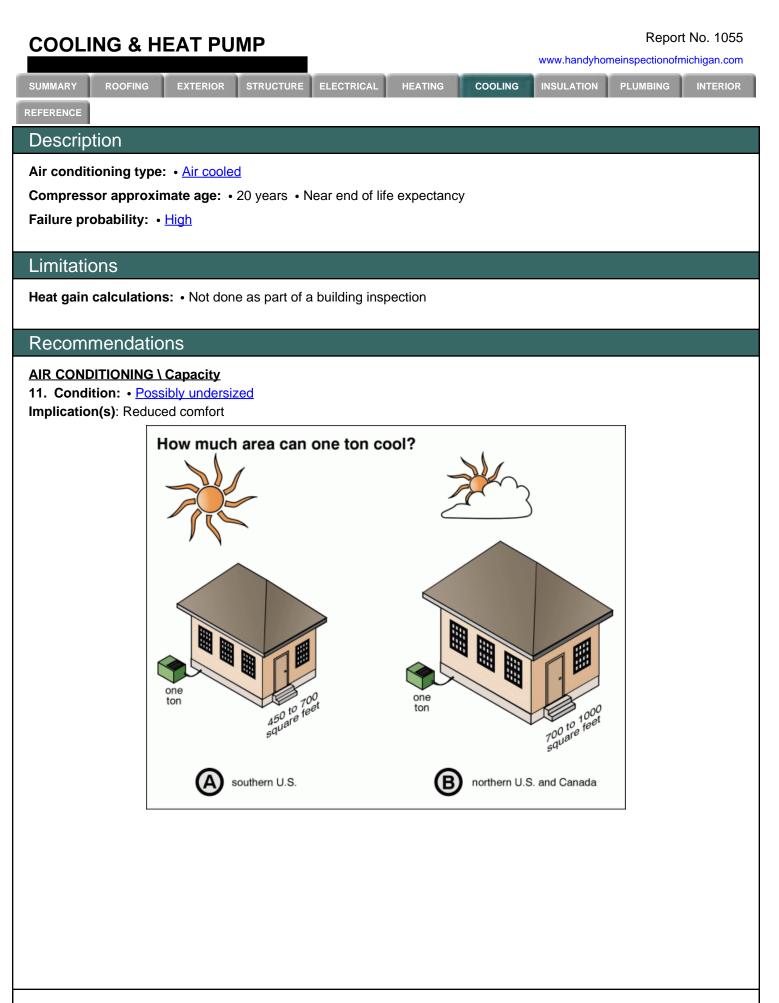

Providing great home inspections for every client every time

INSUL		AND VEI	NTILATI	ON				Repor	t No. 1055
							www.handyhor	meinspectionofr	nichigan.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									

Description

Attic/roof insulation material: • Glass fiber

Attic/roof insulation amount/value: • Not determined

Attic/roof air/vapor barrier: • Not determined

Attic/roof ventilation: • Roof vent • Soffit vent

PLUMBING

www.handyhomeinspectionofmichigan.com

								· · · ·	Ŭ
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									
Descrip	tion								
Water sup	oply source:	• Public							
Service p	iping into bi	uilding: • <u>Pla</u>	astic						
Supply pi	ping in build	ding: • <u>Copp</u>	<u>)er</u>						
Main wate	er shut off v	alve at the:	 Meter 						
Water hea	ater type: •	Conventional	l						
Water hea	ater fuel/ene	ergy source:	• <u>Gas</u>						
Waste an	d vent pipin	g in building	j: • <u>PVC pla</u> :	<u>stic</u>					


Limitations


Items excluded from a building inspection: • Water quality • Septic system • Isolating/relief valves & main shutoff valve • Concealed plumbing • Tub/sink overflows • Water treatment equipment • The performance of floor drains or clothes washing machine drains • Pool • Pool • Spa

Recommendations

WASTE PLUMBING \ Sump pump

12. Condition: • Inoperative Implication(s): Chance of water damage to contents, finishes and/or structure

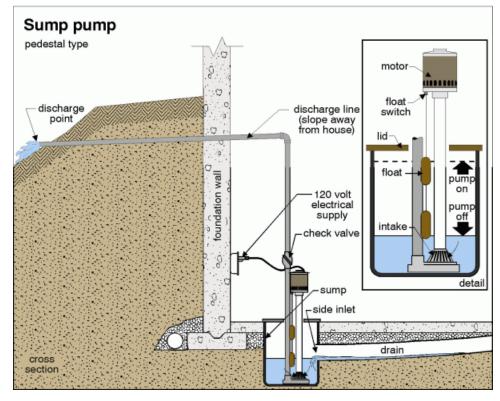

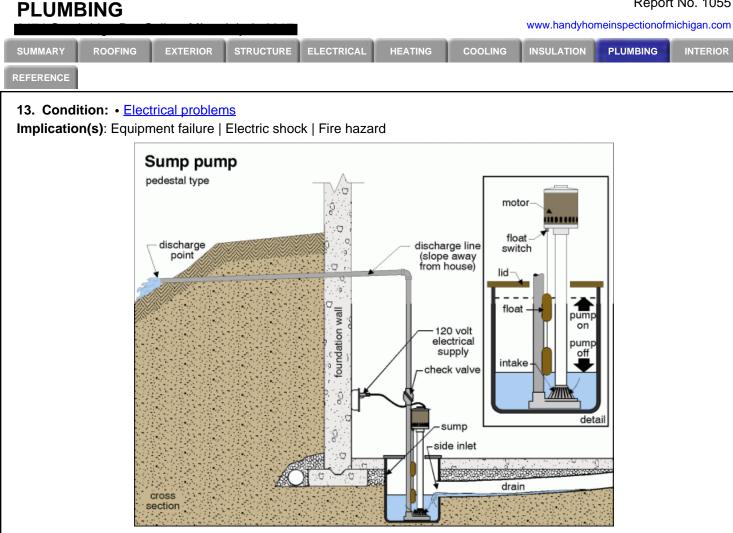

FIXTURES AND FAUCETS \ Faucet

14. Condition: • Drip, leak

Implication(s): Chance of water damage to contents, finishes and/or structure

Location: Kitchen

Task: Replace

Time: Immediate

Cost: Minor

PLUME	BING						www.handyho	Repor meinspectionofr	t No. 1055 nichigan.com
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									
		197		1	-			1 - Second Second	





47. Drip, leak

48. Drip, leak

INTERIOR

 SUMMARY
 ROOFING
 EXTERIOR
 STRUCTURE
 ELECTRICAL
 HEATING
 COOLING
 INSULATION
 PLUMBING
 INTERIOR

 REFERENCE
 Description
 Major floor finishes: • Carpet • Hardwood • Ceramic
 Vindows: • Single/double hung • Wood
 Glazing: • Double
 Vood

Exterior doors - type/material: • Hinged • Sliding glass

Kitchen ventilation:
 Range hood

Bathroom ventilation: • Exhaust fan

Laundry room ventilation: • Clothes dryer vented to exterior

Limitations

Not included as part of a building inspection: • Carbon monoxide detectors • Security systems and intercoms • Central vacuum systems • Cosmetic issues • Appliances • Perimeter drainage tile around foundation, if any

Recommendations

WINDOWS \ Frames 15. Condition: • Rot Implication(s): Chance of damage to structure | Material deterioration Location: Various Task: Replace Time: Discretionary Cost: Major

www.handyhomeinspectionofmichigan.com



SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
REFERENCE									
		Causes of	rot						
		wood is vulnerat	ble to rot attack		۵				
		when the moistu above 20%			6				
		air must also be totally submerge rot very slowly, o	present (wood d in water will r not at all)						





49. Rot

50. Rot

INTERIOR

SUMMARY	RO
---------	----

REFERENCE

- STRUCTURE ELECTRICAL

PLUMBING INTERIOR

www.handyhomeinspectionofmichigan.com







DOORS \ Storms and screens

16. Condition: • Missing Implication(s): Increased heating and cooling costs | Reduced comfort Location: Various Task: Replace Time: Discretionary

END OF REPORT

Providing great home inspections for every client every time

REFERENCE LIBRARY

Report No. 1055

www.handyhomeinspectionofmichigan.com



Providing great home inspections for every client every time

Page 28 of 28